
## PORCELANOSA Grupo

Model: DOVER MODERN LINE ARENA 31,6X90(A) Codes: 100155623 - P34707621 Water absorption: BIII Thickness: 11.4 mm





| DIMENSIONAL FEATURES<br>UNE-EN ISO 10545-2       |  |                |
|--|--|----------------|
| Thickness  | 11.4 MM  |                |
| Width  | 314.98 MM  |                |
| Length   | 900 MM   |                |
| Length and width deviation                       | Below 0.15%  | <=0.5 %*       |
| Side straightness deviation                      | Below 0.15%  | <=0.5 %*       |
| Squareness deviation                             | Below 0.15%  | <=0.6 %*       |
| Surface flatness deviation                       | Below 0.15%  | <=0.5 %*       |
| *ISO-13006:2012 UNE-EN 14411:2012                |  |                |
|  | MECHANICAL FEATURES<br>UNE-EN ISO 10545-4-6-7-11   |                |
| Breaking strength                                | 1936 N   | >600 N*        |
| Crazing resistance                               | Resists 3 cycles   |                |
| *ISO-13006:2012 UNE-EN 14411:2012                |  |                |
| HYGIENIC FEATURES<br>UNE-EN ISO 10545-13-14:1995 |  |                |
| Chemical resistance                              | Class "A"" for swimming pools and cleaning products<br>(resists attack). Minimum Class ""B"" for acids and<br>bases" | CLASE B Min. * |
| Stain resistance                                 | Class 5. Easy cleaning with water  | CLASE 3 Min. * |
| *ISO-13006:2012 UNE-EN 14411:2012                |  |                |
| SCOPE OF USE                                     |  |                |
| Technical code-1                                 | Use on walls   |                |
| PACKING  |  |                |
| Boxes  | 0.8532 M2/CS   |                |
| Pallets  | 48.632 M2/PAL  |                |
| Units  | 0.2844 M2/ST   |                |

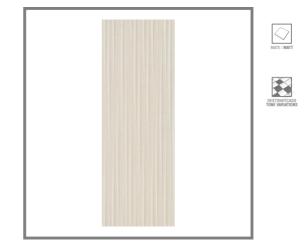

Do not use cleaning agents containing hydrofluoric acid. It is recommended to fix tiles with a minimum joint of 1,5 mm. Do not fix without joint. For big sizes, it is recomended to fix with mortars containing polymeric additives and to use the double glueing technique. Mosaic tiles must be grouted. This document is only commercial and cannot be used as expert opinion, documentary evidence or in any legal or administrative procedure unless authorized by PORCELANOSA S.A.