

V50300111
100160949

HOUSTON TAUPE


VENIS
PORCELANOSA Grupo

Model: HOUSTON TAUPE 29,4X120(A)

Codes: 100160949 - V50300111

Water absorption: Bla - Porcelain tiles ($E \leq 0.1\%$)

Thickness: 10.5

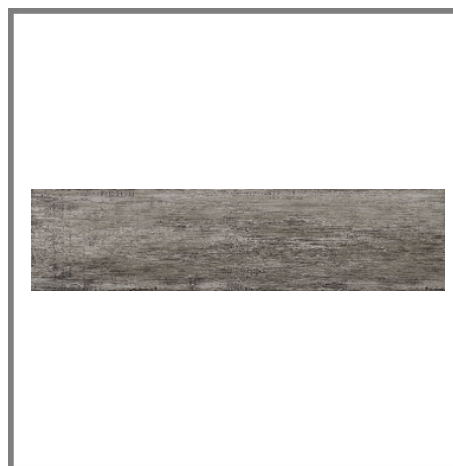

MATE / MATT



RECTIFICADO
TONE VARIATIONS



RECTIFICADO
RECTIFIED

DIMENSIONAL FEATURES

UNE-EN ISO 10545-2

Thickness	10.5	
Width	294	
Length	1200	
Length and width deviation	Below 0.15%	$\leq 0.5\%$ *
Side straightness deviation	Below 0.15%	$\leq 0.5\%$ *
Squareness deviation	Below 0.15%	$\leq 0.6\%$ *
Surface flatness deviation	Below 0.15%	$\leq 0.5\%$ *

*ISO-13006:2012 UNE-EN 14411:2012

MECHANICAL FEATURES

UNE-EN ISO 10545-4-6-7-11

Crazing resistance	Resists 3 cycles	
--------------------	------------------	--

*ISO-13006:2012 UNE-EN 14411:2012

HYGIENIC FEATURES

UNE-EN ISO 10545-13-14:1995

Chemical resistance	Class "A" for swimming pools and cleaning products (resists attack). Minimum Class "B" for acids and bases	CLASE B Min. *
Stain resistance	Class 5. Easy cleaning with water	CLASE 3 Min. *

*ISO-13006:2012 UNE-EN 14411:2012

SCOPE OF USE

Technical code-1	Use on heavy traffic floors	
------------------	-----------------------------	--

ANTI-SLIP VALUE

UNE-ENV 12633:2003, DIN-51130 y ASTM C1028

Slip resistance (ramp)	R-10	
------------------------	------	--

*ISO-13006:2012 UNE-EN 14411:2012

PACKING

Boxes	1.4112 M2/CS	
Pallets	45.1579 M2/PAL	
Units	0.3528 M2/ST	

System Certification



Do not use cleaning agents containing hydrofluoric acid.
It is recommended to fix tiles with a minimum joint of 1.5 mm. Do not fix without joint.
For big sizes, it is recommended to fix with mortars containing polymeric additives and to use the double glueing technique.
Mosaic tiles must be grouted.

This document is only commercial and cannot be used as expert opinion, documentary evidence or in any legal or administrative procedure unless authorized by PORCELANOSA S.A.
A DCOF value of > 0.42 is the new standard for tiles specified for commercial level interior applications expected to be walked upon when wet, in standard A137.1:2012. It replaces the SCOF value of > 0.60 referenced in ADA Guidelines (measurement made as per the ASTM C1028 test method). However, there are many factors that affect the possibility of a slip occurring and then tiles with a DCOF of 0.42 or greater are not necessarily suitable for all projects. The specifier shall determine if tiles are appropriate for specific project conditions, considering by way of example, but not limited to: type of use, traffic, expected contaminants, expected maintenance, expected wear and manufacturer guidelines and recommendations. Tiles with a DCOF inferior to 0.42 shall only be installed when the surface will kept dry when walked upon and proper safety procedures are followed when cleaning the tiles.